



Eliminating Noise during Dual Zone Audio mode with the OS-4.

Pacific Accessory Corporation



This note only pertains to P.A.C. part number OS-4 with a lot number of 002, 003 and 004.

- The lot number is located on the revision number sticker (found on the blue interface case).
- If RSE controls are not present in your vehicle there is no need to perform the connections in this note.
 - If your vehicle is not equipped with OnStar and Bose there is no need to perform the connections in this note.

If engine noise is present in the rear speakers when using the dual zone function of the RSE controls or during OnStar:

1. Disconnect the OS-GMLAN29 harness from the vehicle.
2. Locate the Black/White wire terminated at c2 pin 8 (16 pin GM connector)
3. Cut this wire in half.
4. Re-attach this wire by connecting a 3.9k ohm resistor in series (Orange, White, Red, Gold). One side of the resistor to one side of the wire. Other side of the resistor to the other side of the wire.
5. Insulate the new connection and reconnect the OS-GMLAN29 harness to the vehicle and OS-4.

